# **Driving Mobile Media Solutions**

#### ALPINE ELECTRONICS OF ASIA PACIFIC CO., LTD.

555 Rasa Tower 1, Unit 2601-2602, 26th Floor, Phaholyothin Rd., Chatuchak, Bangkok, Thailand 10900 Tel: +662-937-0505 Fax: +662-937-0569

http://www.alpine-asia.com

### KTX-WXE-M38

## 

Car Model	Model Year	
MAZDA 3	2012	


# INSTALLATION KIT **Owner's Manual**

This owner's manual will give you clearly understanding about installation. For making installation correctly, please read this manual carefully before operating installation.


#### 1 Component Parts

Audio Panel	Alpine-Mazda power cord	Alpine-Mazda Antenna cable	Bracket

#### 2 Connecting Diagram

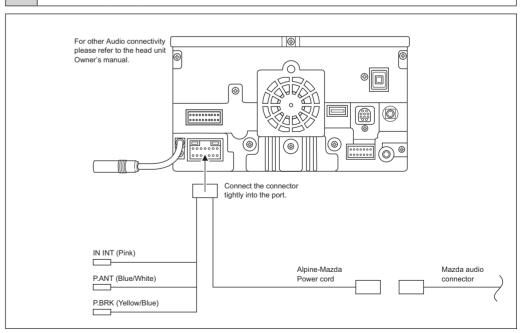

#### 3 Removing Vehicle Parts

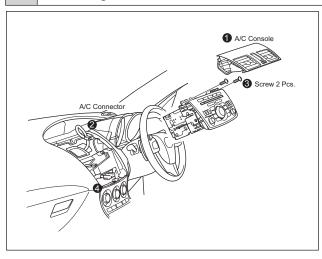


- 1. Remove A/C console **1** by removing 2 clips off.
- 2. Remove A/C connector 2 from A/C console.
- 3. Remove all 2 screws 3.
- 4. Remove all connectors 4 from the head unit. Then, remove the head unit.

#### !!! Caution !!!


Make sure that all the accessories are off so that you do not cause a spark.

#### 5 Bracket Assembly

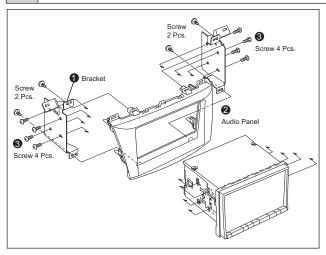

- Install bracket 1 both left and right side of the audio panel by using 4 screws (2 screws each side).
- Install audio panel 2 into the head unit by <u>insert from rear</u> side of the head unit.
- Drive 8 screws (4 screws each side) to make it tight between bracket and the head unit.

#### 4 Harness Connection

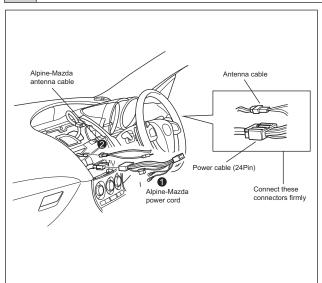


- Connect the Alpine-Mazda power cord 1 into the car connectors.
- Connect the Alpine-Mazda antenna cable 2 into the car antenna connector.

#### !!! Caution !!!

Make connection between connectors tightly (until you hear "Click".)

#### Retracing Vehicle Parts

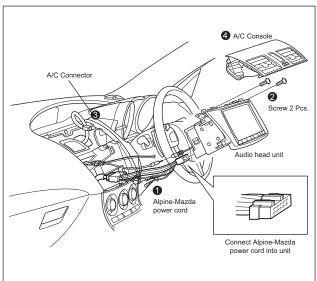

- Connect Alpine-Mazda connector into the head unit tightly until you hear "Click".
- Drive 2 screws 2 to make it tight between the head unit and car console.
- 3. Connect A/C connector 3 with A/C console.
- Install A/C console 4 into car console by pressing all clips to dash panel until you hear "Click".

#### Remark

3

Perform full function checks for the head unit. If no problem found assemble back all the parts to their original position.